



PSS 20 Clear



WORKING WITH NATURE

Application of PSS 20 Clear on the surfaces to be protected

- PSS 20 Clear Container and airless spraygun.



- Porous substrates: wet well with water prior to application of PSS 20 Clear. Non-porous substrates: do not wet with water prior to application of PSS 20 Clear.




- Spray PSS 20 Clear on the surface. Overlapping application, vertically (up/down) and horizontally (left/right) which equals 'one layer'. Apply a second and, if necessary, a third 'layer' on the well dried previous layer.




Removal of graffiti from PSS 20 Clear protected surfaces

- Activate PSS 20 Clear film around the graffiti with hot water (about 70 °C) and very low water pressure (< 5 bar, water on/off). PSS 20 Clear film begins to swell. Allow the hot water to penetrate into the PSS 20 Clear film underneath the graffiti paint during 3-4 minutes.

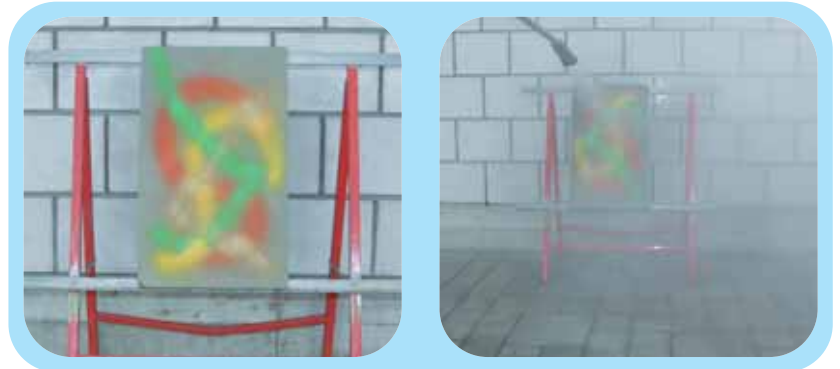

- After the 3-4 minutes activation period with hot water start 'peeling' the graffiti off (waterjet at about 30-45 ° angle) using again hot water and a water pressure adapted to the surface (between 5 – 50 bar) and by approaching the graffiti alternating from all sides. The graffiti paint will fall in small pieces on the floor and can thereafter be brushed up.

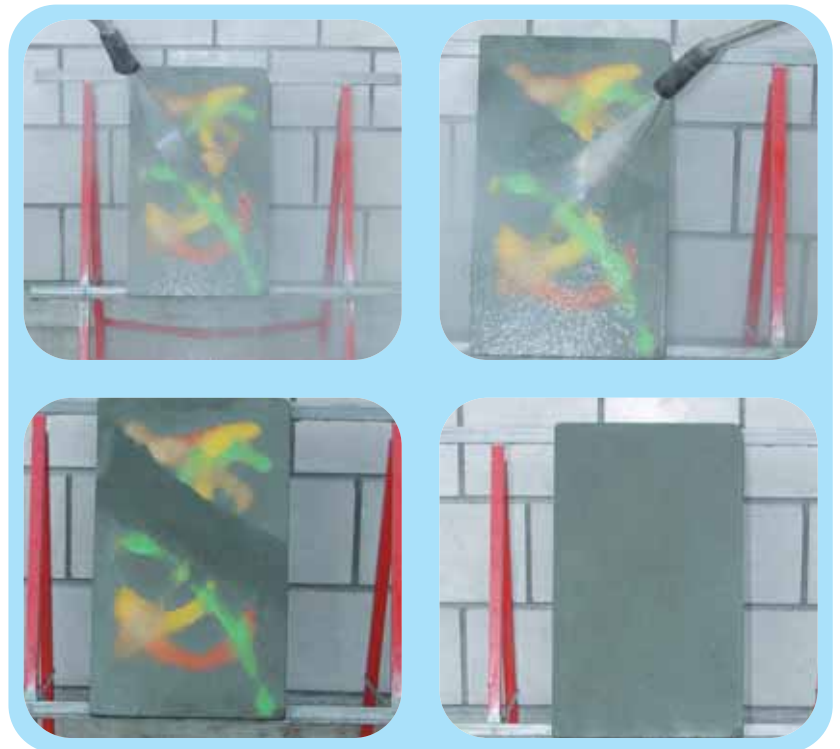

- Porous substrates: Apply PSS 20 Clear immediately after the graffiti removal whilst the substrate is still wet (but not dripping anymore). Non-porous substrates: Wait until the surface is dry, then apply PSS 20 Clear.

